

Technical Bulletin



Chevrolet, GMC and Dodge Truck Release Problems

Vehicles: Chevrolet, GMC and Dodge Trucks

LuK Part Numbers: 04-064, 04-087, 04-105, 04-902, 05-062

Use of oversized lock washers on the clutch mounting bolts of these trucks with 12-inch clutches can cause release problems. The larger diameter of the washers can extend through the cutouts in the clutch far enough to contact the disc. Use only standard $\frac{3}{8}$ -inch diameter lock washers or thread locking compound and torque the bolts to manufacturers' specifications.

For application, diagnostic or installation questions, call the LuK Technical Hotline at 800-274-5001, 8:00 a.m. to 5:00 p.m. ET Monday through Friday, or check online at www.lukclutch.com.

Schaeffler Group Automotive

United States

5370 Wegman Drive
Valley City, OH 44280
Phone 800 274 5001
Fax 330 273 3522

Canada

2871 Plymouth Drive
Oakville, ON L6H 5S5
Phone 800 261 8111
Fax 905 829 9034

Web www.lukclutch.com

Chevrolet, GMC y Dodge Truck Problemas de Liberación

Vehículos: Chevrolet, GMC and Dodge Trucks

**Números de Parte LuK: Numbers: 04-064, 04-087, 04-105,
04-902, 05-062**

El uso de arandelas de presión sobremedida en los tornillos de montaje del embrague en estas camionetas con embragues de 12-pulgadas puede causar problemas de despegue del embrague. El diámetro más grande de las arandelas puede extenderse através de los cortes del embrague lo bastante lejos hasta entrar en contacto con el disco. Utilize solamente arandelas de presión estándar de $\frac{3}{8}$ de pulgada de diámetro o use un compuesto para sellar las roscas y apriete los tornillos a las especificaciones del fabricante.

Para preguntas sobre aplicaciones, instalación o diagnóstico, llame a la línea rápida de servicio técnico de LuK al 800-274-5001, de 8:00 a.m. a 5:00 p.m. de lunes a viernes, o visítenos en línea en www.lukclutch.com.

Problèmes de débrayage – Camions Dodge, GMC et Chevrolet

Véhicules: Chevrolet, GMC and Dodge Trucks

**Pièces LuK n^{OS}: Numbers: 04-064, 04-087, 04-105, 04-902,
05-062**

L'utilisation de rondelles de sécurité trop grandes sur les boulons de montage de l'embrayage de ces camions ayant des embrayages de 12 po peut causer des problèmes de débrayage. À cause de leur diamètre excédentaire, ces rondelles peuvent dépasser les découpes dans l'embrayage et toucher le disque. N'utiliser que des rondelles de sécurité de $\frac{3}{8}$ de po ou un adhésif frein-filet et serrer au couple les boulons selon les spécifications du fabricant.

Pour toute question en matière d'application, de diagnostic ou d'installation, téléphoner au soutien technique LuK, au 800-274-5001, du lundi au vendredi de 8h à 17h HE, ou consulter le site www.lukclutch.com.